




Torx Button Head Screws With Flange

A 6 lobe or torx driven variant of the popular flanged socket button screw. Again, torx button flange screws can be employed where aesthetics are important, or where space is limited.

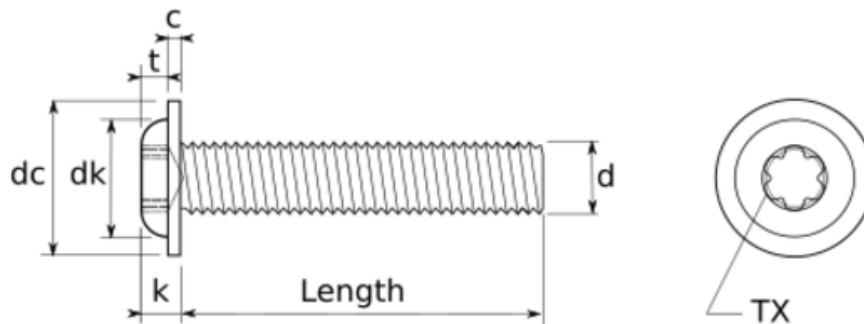

d	dc min.	dc max.	dk min.	dk max.	k min.	k max.	c min.	c max.	t	TX
M3	6.30	6.90	4.90	5.20	1.40	1.65	0.50	0.70	0.80	T10
M4	8.80	9.40	6.80	7.20	1.95	2.20	0.60	0.80	1.05	T20
M5	11.10	11.80	8.40	8.80	2.50	2.75	0.80	1.00	1.30	T25
M6	12.90	13.60	9.60	10.00	3.00	3.30	1.00	1.20	1.60	T30
M8	17.10	17.80	12.80	13.20	4.10	4.40	1.20	1.50	2.40	T40
M10	21.00	21.90	16.10	16.50	5.20	5.50	1.50	1.90	2.90	T50